


# MODEL SMA WITH LUMBERG CONNECTOR CALIBRATION CERTIFICATE INSTALLATION INFORMATION


#### INSTALLATION DIMENSIONS

	1	2	3	4
in.	0.38	1.38	1.38	0.56
mm	9.53	35.0	35.0	14.2

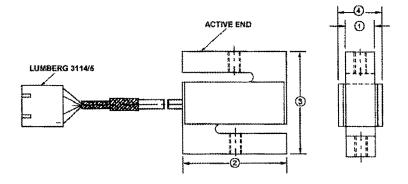

## **ELECTRICAL INFORMATION**

The SMA is supplied with a 4-conductor shielded cable (AWG28) 18 inch (-251) or 40 inch (-304) long. The shield is isolated from load cell body.

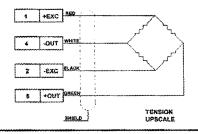

#### APPLICATION NOTES

- The SMA is intended for controlled environment applications. It may be used in humidity up to 95% RH non condensing. It is not recommended for exposure to spray or submersion.
- At least one diameter thread engagement is desirable; normal engagement is 1/4 to 1/2 inch (6-12 mm).
- Bottoming out of the mounting stud can cause irreparable damage to the load cell.

- Jam nuts may be used; however, react torque only on the load cell structure adjacent to the jam nut.
- 5. The force to be measured should be applied to the active end of the cell to eliminate possible errors due to cable interaction. The active end of the cell is separated from the cable/connector side by the slot(cutout) in the flexure.

### PERFORMANCE SPECIFICATIONS

Rated Output (RO) Nonlinearity Hysteresis 2.5 ±0.125 mV/V <±0.05 %FS <±0.05 %FS

Temperature Range, Compensated Temperature Range, Operating Temperature Effect on Output Temperature Effect on Zero 15 to 115°F -65 to 200°F <±0.0008%/°F <±0.005%RO/°F

Zero Balance Input Resistance Output Resistance Excitation Voltage, Recommended -0.6 to 0%RO 350 ohms +40,-3.5 350 ohms ±3.5 10 VDC or VAC

Interface, Inc. 7401 E. Butherus Dr., Scottsdale, AZ 85260 USA, 480-948-5555 www.interfaceforce.com